

HILO, HAWAII

AL-756 (FAA)


VOR/DME or TACAN-A HILO INTL (ITO) (PHTO)

VORTAC ITO 116.9 Chan 116	APP CRS 145°	Rwy Idg TDZE Apt Elev	N/A N/A 38
---	------------------------	-----------------------------	---------------------------------------

⚠ Circling not authorized south of Rwy 8-26.


MISSED APPROACH: Climbing left turn to 3000 via ITO R-079 to VEWES/5 DME and hold.

ATIS 126.4	HILO APP CON 119.7 269.2	HILO TOWER ★ 118.1 (CTAF) 263.1	GND CON 121.9
----------------------	------------------------------------	---	-------------------------

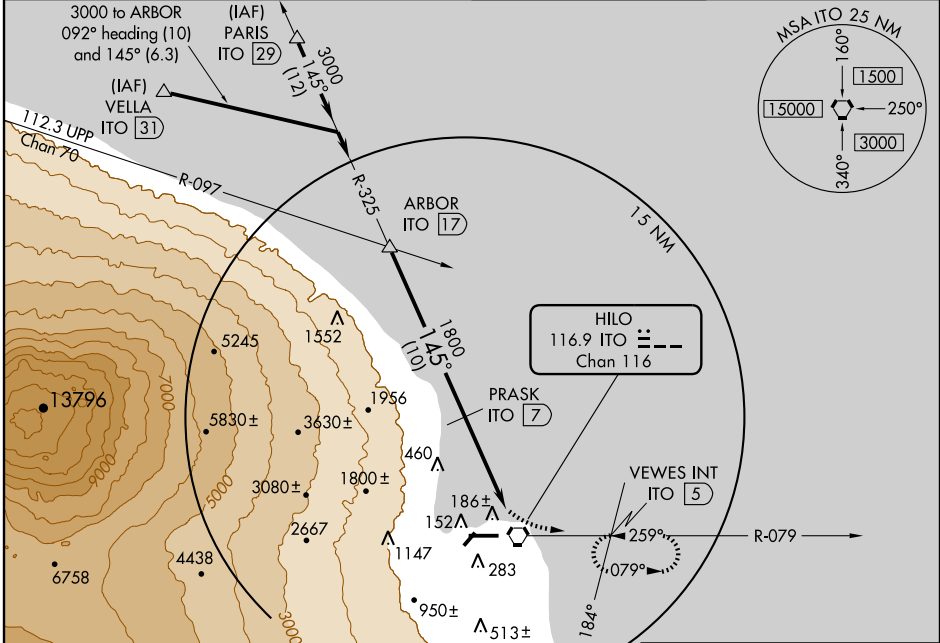


PAC, 27 AUG 2009 to 22 OCT 2009

PAC, 27 AUG 2009 to 22 OCT 2009

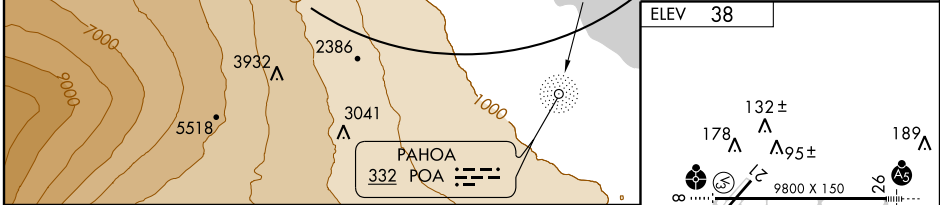

ARBOR ITO 17	3000	145°	PRASK ITO 7	1800	ITO 1	3000	VEWES INT
Procedure Turn NA							
	10 NM		6 NM				

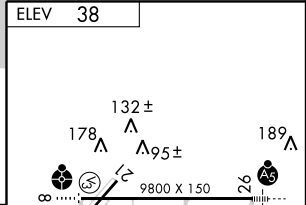

CATEGORY	A	B	C	D	REIL Rwy 3
CIRCLING	500-1½	462 (500-1½)		700-2	MIRL Rwy 3-21
				662 (700-2)	HIRL Rwy 8-26

HILO, HAWAII
Amdt 7B 09071

19°43'N-155°03'W

HILO INTL (ITO) (PHTO) VOR/DME or TACAN-A